

Work Order ID 162057

Wednesday, May 24, 2017 10:05:03 AM

162057 Ship Alone

Page 1

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly

Start Date: 5/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 6/2/2017 Req'd Qty: 1.00 ***1*** Customer:

Reference: DAS

Approvals: Process Plan: 9-88 Date: MAY 24 2017 Tooling: Date: Run Start ***NR1***
 QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D3391	J

100

100

Skidtubes

Skidtubes

Skidtubes

Memo

1-Cut tube to finish length as per Dwg D3391

2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

3-Open aft saddles and GHW holes to Ø0.4375" except for fwd saddle holes

4-Remove .030" from Fwd indexing Ridge as per Dwg D3391

5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

6-Deburr, scibe batch # on aft end.

7- Locate D3391-021 in D3391-023 at 9.00" (see view F-F)

8- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect alignment, open up previously transfer drilled pilot holes in D3391-023-021 using drill press.

ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per

ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499".

D3391-021 BATCH:

9- Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.375" holes with

Open Fwd Saddle holes per drawing

B162057

DAS
03
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 162057

162057

Page 2

Wednesday, May 24, 2017 10:05:03 AM

Item ID: D3391-023 Accept *N900040100* Setup Start *NS1*
 Revision ID:
 Item Name: Mid Tube Assembly Stop *NS2*
 Start Date: 5/24/2017 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 6/2/2017 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	paint marker, ***DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG*** Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplate holes in D3391-021 using DT8937 10- Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.375" (10 holes) as per Dwg D3391 Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391 Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end. 11- Open 10 wearplate holes in D3391-021 to 0.297" dia. 12- DEBURR AND BLOW OUT CHIPS								
110	QC5- Inspect part completeness to step on W/O	0.00							
110									
QC	Memo	0.02							
Quality Control									

DAG
38

JUN 15 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date: _____	Step #: _____	QTY Effective: _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER: _____					

Work Order ID 162057***162057***

Page 3

Wednesday, May 24, 2017 10:05:03 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 5/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/2/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.26							
Hand Finishing									
130	QC7-Inspect Chemical Conversion Coat	0.00							
130									
QC	Memo	0.02							
Quality Control									

Handwritten notes: 120 of 1200015, DAS 37 8-89 17-06-15

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
*Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Wednesday, May 24, 2017 10:05:03 AM

Item ID: D3391-023

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 5/24/2017 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 6/2/2017 Req'd Qty: 1.00 * 1 *

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID	Tool #	Plan Code
---------	--------	-----------

**Accept
Qty**

Reject Qty

Reject
Number

Insp. Stamp

140

0.00

140

Skidtubes

0.53

Skidtubes

Memo

1-Open float bag holes as per dwg
2-C'sink float bag holes as per dwg
3- Prepare tube for welding
4-Bond web in place as per Dwg D3391 & QSI 015.
Adhere for 12 hours)

A/R Sikaflex exp: _____

batch#:

NOTE: ENSURE WEB IS INSERTED IN AFT END OF TUBE

150

QC5- Inspect part completeness to step on W/O

0.00

150

QC

Memo

0.02

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 162057

Wednesday, May 24, 2017 10:05:03 AM

162057

Page 5

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 5/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/2/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	Skidtubes	0.00							
160									
Skidtubes	Memo	0.60							
Skidtubes	1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush								
170	QC10- Inspect visual per QSI004- ground welds	0.00							
170									
QC	Memo	0.02							
Quality Control									
180	QC5- Inspect part completeness to step on W/O	0.00							
180									
QC	Memo	0.02							
Quality Control									

A/R M136920 SE1706-16
mbg 17/06/16

DAS 38 9-89 JUN 16 2017

DAS 38 9-89 JUN 16 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Work Order ID 162057

162057

Page 6

Wednesday, May 24, 2017 10:05:03 AM

Item ID: D3391-023 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Mid Tube Assembly
 Start Date: 5/24/2017 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 6/2/2017 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

185 Pressure Wash per QSI005 4.3

0.00

185

HandFinish

Memo

0.40

Hand Finishing

AND REALODINE AS PER PAR09-043

(X1)  282706/19
BIEB

190

0.00

190

SprayPaint

Memo

2.00

Spray Painting

PRIME AS PER DWG AND QSI005 4.2.1.3.3
PRIMER BATCH: _____PAINT AS PER DWG AND QSI005 4.2.2.4
PAINT: _____

P10: 36744

JUN 19 2017

DAS
13
9-89

200

QC14- Inspect Spray Paint

DAS
9
9-89

0.00

200

QC

Memo

0.02

Quality Control

DAS
38
9-89
JUN 20 2017

195 rec'd + inspect

DAS
9
9-89

17.06.20

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 162057

Wednesday, May 24, 2017 10:05:03 AM

162057

Page 7

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 5/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/2/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							
230	HandFinishing								
HandFinish	Memo	0.60							
Hand Finishing	1-Install Inserts as per Dwg								
240		0.00							
240	QC5- Inspect part completeness to step on W/O								
QC	Memo	0.02							
Quality Control									DAS 38 9-89 JUN 20 2017
250		0.00							
250	Identify as per dwg & Stock Location: _____								
Packaging	Memo	0.30							
Packaging	<i>Sold</i>								DAS 28 9-89 DAS 27 9-89 JUN 20 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition				
					Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

Work Order ID 162057***162057***

Page 8

Wednesday, May 24, 2017 10:05:03 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 5/24/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/2/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: Date: Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	QC21- Final Inspection - Work Order Release	0.00							
260									
QC	Memo	0.01							
Quality Control									

17/6/2017

 JUN 20 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
☐ OTHER : _____					

Picklist Print

Wednesday, May 24, 2017 10:05:07 AM

Page 1

Work Order ID: 162057

162057

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 5/24/2017

Required Date: 6/2/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20New Issue KJ/EC
 IPP B06.02.10ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev:I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-100

Manufactured

No

100

Each

22.0000

1

1

D2500-1-100

Skidtube Extrusion

**

17-06-15
D

Location

Loc Qty

Loc Code

HALL

22

133815

22

D3591-1

Manufactured

No

230

Each

67.0000

2

2

D3591-1

Bushing

**

B158739

Location

Loc Qty

Loc Code

FG

10

115645

4

92873

6

FP001

57

109107

2

134643

9

141636

6

149167

3

153743

3

157205

1

157646

3

158739

30

DAS
27
9-89

DAS
28
9-89

JUN 20 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
*Past Expiry Date ☐	☐ Manufacturing Process	OTHER :							
Misidentified ☐	☐ Past Due								

Picklist Print

Wednesday, May 24, 2017 10:05:07 AM

Work Order ID: 162057

162057

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 5/24/2017

Required Date: 6/2/2017

Start Qty: 1.00

Required Qty: 1.00

D3389-1 Manufactured No

140 Each 12.0000 1 1

D3389-1

Web

**

17-06-15

Location	Loc Qty	Loc Code
LG002 161695	12	
154065	2	
158256	5	
158986	5	

D3681-1 Manufactured No

160 Each 88.0000 5 5

D3681-1

Spacer

**

BB17-06-16
B160402x5

Location	Loc Qty	Loc Code
LG001	88	
145956	1	
151967	4	
155381	1	
155806	8	
158384	74	

ALS4-1032-130 AELS4-1032-130 Purchased No

230 Each 3,282.000 20 20

AI S4-1032-130

Rivnut

**

17-06-16

Location	Loc Qty	Loc Code
CCK007	2764	
M136579	2764	
FG	50	FG
M135442	50	
FP001	153	
M133077	3	
M136579	150	
st555	315	
M136579	315	

x20

DQA: _____ Date: _____


WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY																																																											
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	No Re-verification ☐	Operator ☐	Offset/Setup ☐	Supplier ☐	Training ☐	Use for Testing ☐	Poor Information ☐	Rushing ☐	Product Improvement ☐	Process Improvement ☐	Manufacturing Process ☐	Past Due ☐	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	Temperature/Cure ☐	Set-up ☐	BOM/Route ☐	Broken/Damage/Defect ☐	Inspection Incomplete/Unqualified ☐	Contamination ☐	Countersink ☐	Cut Too Short ☐	Instructions Incomplete/Unclear ☐	Drill Holes ☐	Power Loss/Surge ☐	Folio/Program ☐	Grain ☐	Weld ☐	Wrong Stock Pulled ☐	Out of Sequence ☐	Off-set ☐	Mislabeled ☐	Fit/Function ☐	Misaligned/off center ☐	Positioned Wrong ☐	Outside Dimensions ☐	Over/Under tolerance ☐	Part Incorrect ☐	Part Lost/Missing ☐	Part Moved ☐	Drawing ☐	Finish ☐	Misread ☐	Turning Sequence ☐
OTHER : _____																																																															

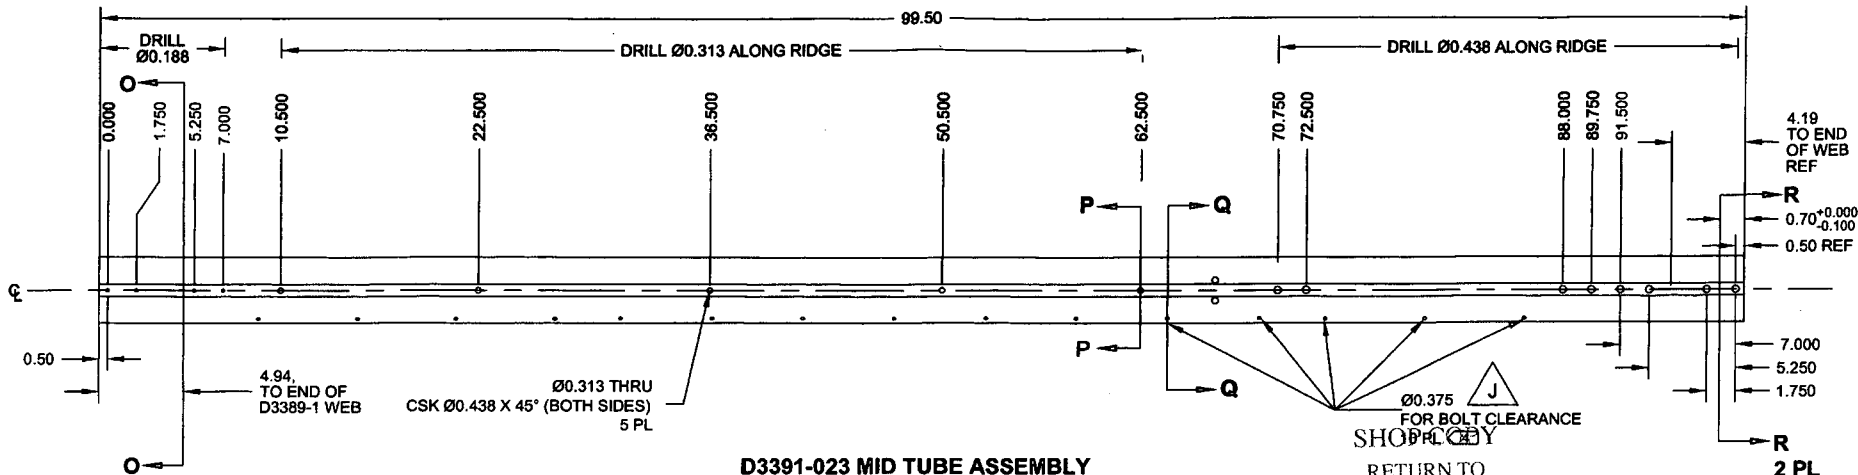


D3391-023 MID TUBE ASSEMBLY


RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 162057
ML5
170524

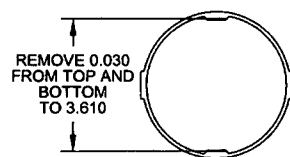


SECTION O-O
SCALE 2X

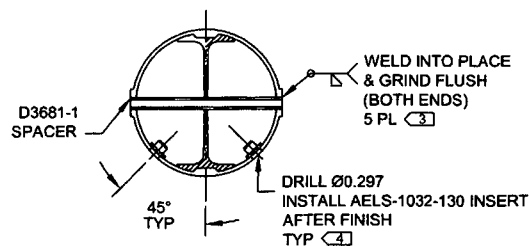

SECTION P-P
SCALE 2X

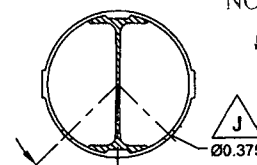

SECTION Q-Q
SCALE 2X <4>

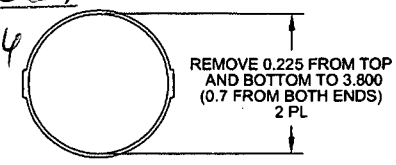

SECTION R-R
SCALE 2X

RELEASED
2016-04-28

D3391-023 MID TUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
1	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT



D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBOR AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	ML	EUGENE, OR
CHECKED	CP	DRAWING NO. D3391
MFG. APPR.		REV. J SHEET 7 OF 11
APPROVED		TITLE 412 FLOAT SKIDTUBE
DE APPR.		SCALE NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

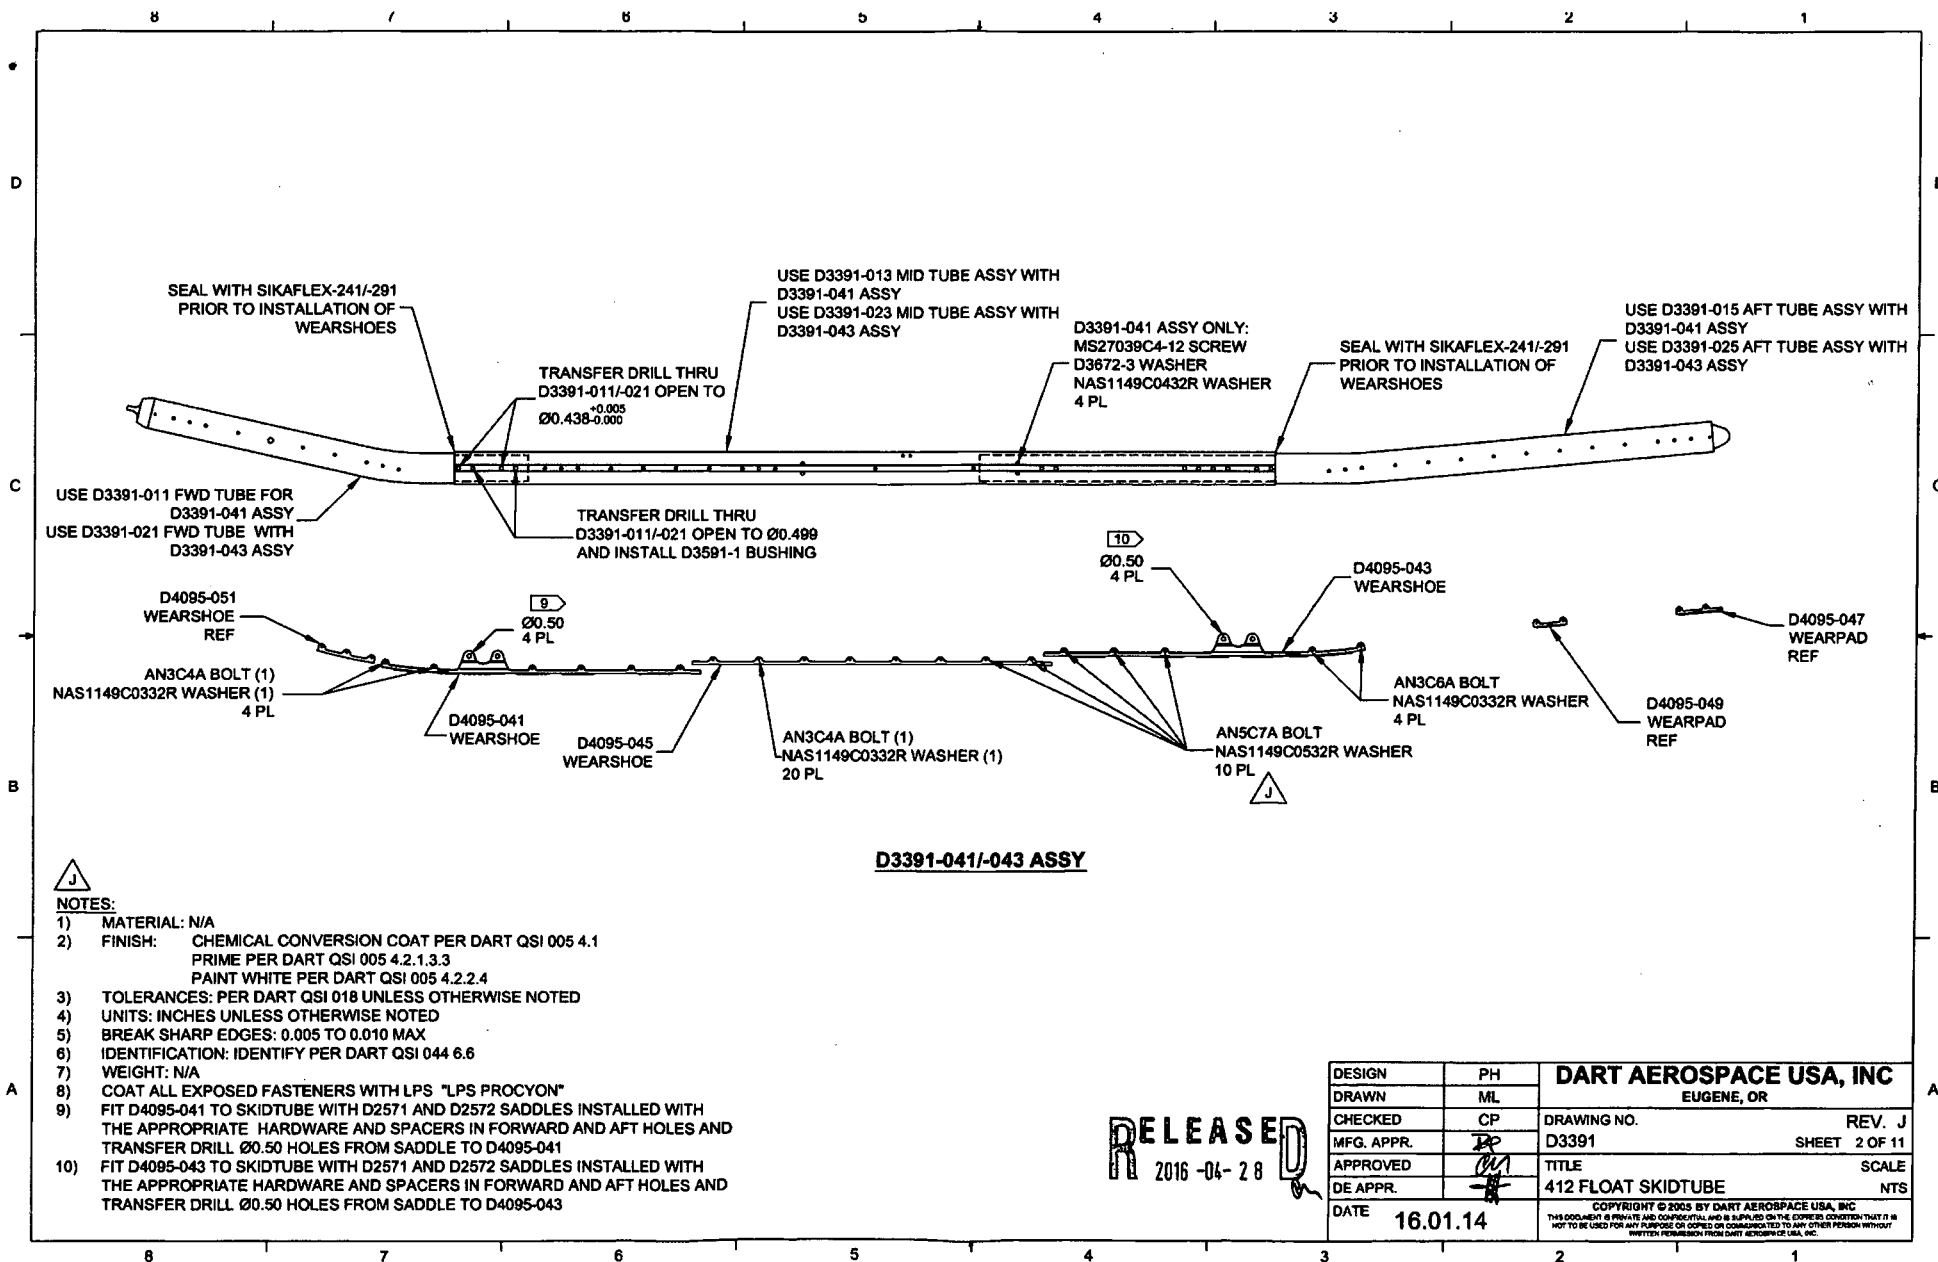



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO36744**

Purchase Order Date 6/19/2017

PO Print Date 6/19/2017

Page Number 1 of 2

Order From :

VC-ATE001

Ship To : DART AEROSPACE LTD

ATELIER DEBOSSSELAGE
358 PRINCIPALE
CALUMET, QC J0V 1B0
CA

1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone 819 242 5633

Buyer

Chantal Lavoie

Customer POID

Customer Tax #

10127-2607

Ship To Contact

Terms

Net 30

Ship To Phone

Currency

CAD

Ship Via:

FOB

Destination-Collect

Ship Acct:

Line Nbr	Reference Vendor Part Number Line Comments Delivery Comments	Description/ Mfg ID	Req Date/ Taxable Promise Date	CD	Req Qty/ Unit of Measure	PO Unit Price	Extended Price
1	159933	D3391-023 MID TUBE	6/29/2017 Yes 6/29/2017		1.00	\$0.00	\$0.00
Line Total:							\$0.00
2	159919	D3391-023 MID TUBE	6/29/2017 Yes 6/29/2017		1.00	\$0.00	\$0.00
Line Total:							\$0.00
3	162057	D3391-023 MID TUBE	6/29/2017 Yes 6/29/2017		1.00	\$0.00	\$0.00

CL

JUN 20 2017

Note:

6/19/2017